

HPH spol.s r.o.

Čáslavská 126
P.O.Box 112
CZ284 01 Kutná Hora
Czech Republic
Tel/Fax 00420-327 513441
e-mail : hph@hph.cz

Mandatory bulletin

No.: G304CZ - 05 a)
G304CZ17 - 05 a)


Type : Type Certificate No.: 98-03
Model: Glasflügel 304 CZ, Glasflügel 304 CZ-17, Glasflügel 304 C
Serial No.: 1 to 60-17

Subject : Airbrake handle check.

Urgency: After receiving of this bulletin, not later than 30.6.2003

Reason: Based on the report from the operation.

Action: Check the joint of the airbrake handle with the rod.

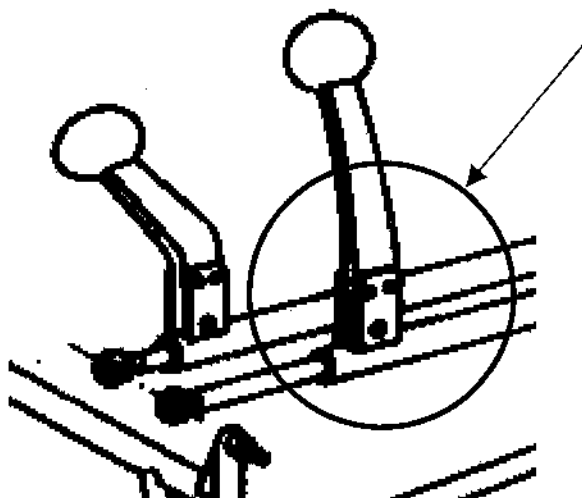

- The joint must be made of three countersink head rivets.
- The joint may not have a free play under operating loads.
- Visually check the material of the rivets.
- Original steel rivets should not be replaced.
- If the duralumin rivets are used then replace them by steel rivets 4x12 DIN 661.
- Secure the joint with the epoxy Loctite 3422
- curing time 2 hours/ 22°C.

Material : Will be supplied by the manufacturer.

Weight : Not changed

C.G. Position : Not changed

Remarks : The technician will record the accomplishing of this Mandatory Bulletin into the operational documents of the sailplane.
Owner covers the expenses of the action.

Technically approved by the Czech Civil Aviation Authority.

Kutná Hora
26.03.2003

Ing. Jiří Hodan