
HPH spol.s r.o. Čáslavská 234 CZ284 01 Kutná Hora Czech Republic Tel/Fax 00420-327 513441 e-mail : info@hph.cz	Service bulletin		No.:	HPH 304TS – 01 a)
	TC no.: Model:	EASA.A.628 HPH 304TS		
	s/n:	all		
		of a cable grommet in luggage compartment		
- 33	Action 1: Action 2:	Before next flight Before next flight, if cable grommet is damaged or not present		
	If a cable grommet in luggage compartment is lost a repetitive movement of cables against uncovered edge of an opening in the compartment floor cover may damage the cables, preventing propeller extension and/or short actuator circuit.			
	<text><text><image/></text></text>			
Page 1/3				
HPH, spol.s.r.o. Čáslavská 234 CZ284 01 Kutná Hora Czech republic		ontent of this document has been pron n alternative procedure to DOA no.	oduced in	Datum 11.06.2025 EASA DOA AP no. 198 Issued by Jaroslav Potměšil

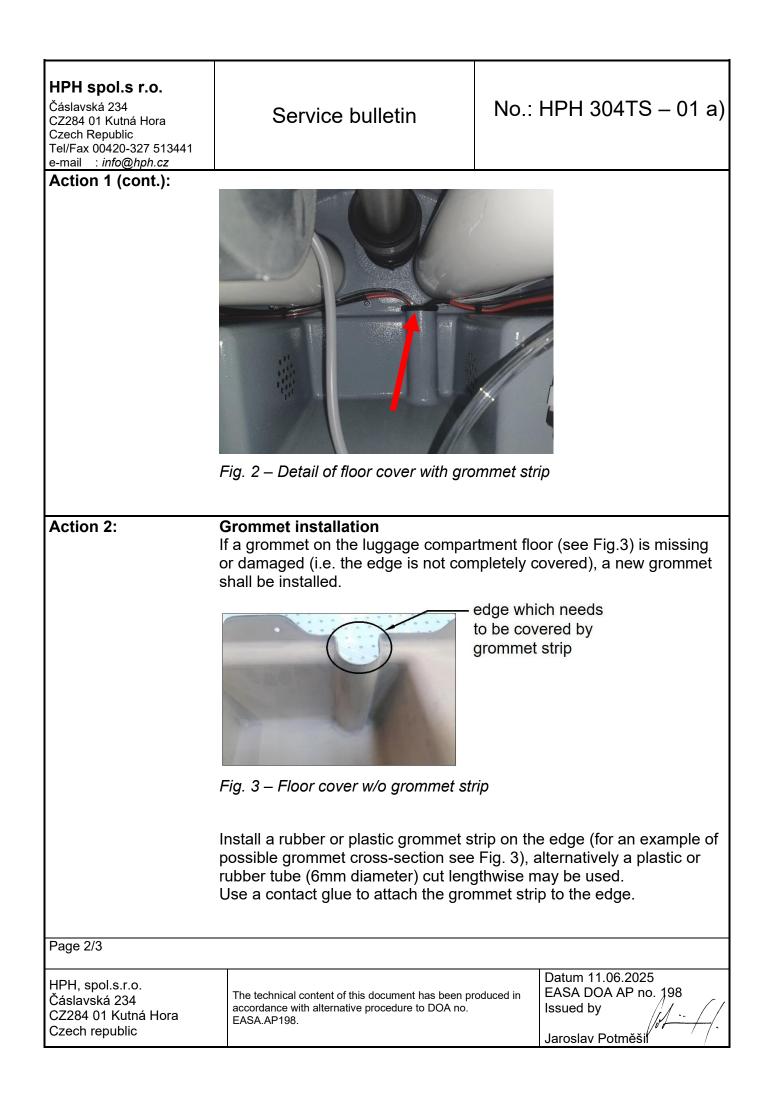

HPH spol.s r.o. Čáslavská 234 CZ284 01 Kutná Hora Czech Republic Tel/Fax 00420-327 513441 e-mail : <i>info@hph.cz</i>	Service bulletin	No.: HPH 304TS – 01 a)			
Action 2 (cont.):	2 0 0 0 0 0 0 0 0 0 0 0 0 0				
	Fig. 4 – possible grommet strip cross	s-sections amet strip assembly			
	Fig. 5 – Floor cover with attached grommet				
Material :	 plastic / rubber grommet strip or a plastic / rubber tube (6mm diameter) Contact glue 				
Weight :	Negligible				
C.G. Position :	Negligible				
Remarks:	Actions may be performed by pilot/o Action costs are covered by owner	wner			
Page 3/3					
HPH, spol.s.r.o. Čáslavská 234 CZ284 01 Kutná Hora Czech republic	The technical content of this document has been pr accordance with alternative procedure to DOA no. EASA.AP198.	roduced in Datum 11.06.2025 EASA DOA AP no. 198 Issued by Jaroslav Potměšil			