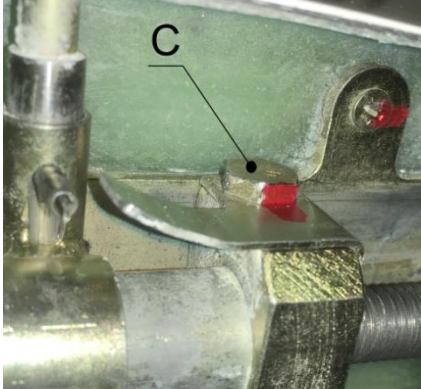
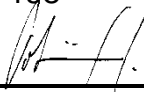


HPH spol.s r.o. Čáslavská 234 CZ284 01 Kutná Hora Czech Republic Tel/Fax 00420-327 513441 e-mail : hph@hph.cz	Service bulletin	No.: G304MS - 11a) G304 S - 11a) G304eS - 11a)
Type : Subject : Urgency: Reason Action 1: Action 2: Material : Weight : C.G. Position : Remarks :	Type Certificate No.: EASA.A.030 Model: Glasfúgel 304 MS, 304 S, 304eS Serial No.: all (114-MS and subsequent as serial production) Additional securing of pin retraction mechanism at wing extension connection. Action 1 - check of securing screw - before next flight Action 2 - additional securing screw installation - during following annual inspection Excessive rigging loads during insertion/retraction of the pin could cause loss of the mechanism function. Then disassembly of the wing tip extension could be blocked. Check position mark on the screw C (see fig.1). If the screw is NOT swiveled, Action 1 is finished. If the screw was turned from original position, the screw must be tightened again and position mark renewed. Installation of securing screw according to technological process: 304S-58-201. Material according to the technological process No.: 304S-58-201 N/A. N/A All maintenance work must be carried out and certified by qualified and authorized personal. Owner covers expenses of the action.	<div style="text-align: center;">fig. 1</div> 
Page 1/1		
HPH, spol.s.r.o. Čáslavská 234 CZ284 01 Kutná Hora Czech republic	4.7.2019 EASA DOA AP no: 198 Jaroslav Potměšil 	EASA approval no.: 10071733